DISPOSAL/REMEDIATION CODES

EXTERIOR REMEDIATION

PCB-01 Remove existing exterior caulking at all masonry openings for disposal as PCB Waste >1 PPM <50 PPM. Note caulking also contains asbestos.

PCB-02 Remove and dispose of non-porous window & door assemblies including glass, glazing compounds, panels, insulation, etc. as PCB Waste >1 PPM <50 PPM. Note glazing also contains asbestos.

PCB-03 Remove existing exterior expansion joint caulk for disposal as PCB Waste >1 PPM <50 PPM. Note caulking also contains asbestos.

PCB-04 Remove existing exterior through wall flashing caulk for disposal as PCB Waste >1 PPM <50 PPM. Note caulking also contains asbestos.

PCB-05 Remove existing black fill material and dispose of as PCB Waste >1 PPM <50 PPM.

PCB-06 Remove existing exterior caulk from the chimney locations and dispose of as PCB waste >1 PPM <50 PPM.

INTERIOR REMEDIATION

PCB-07 Remove existing interior metal column to block caulk and existing interior non-glazed porous cinderblock a minimum of one full block from both sides of the metal column and dispose of as PCB Bulk Product Waste >50 PPM. Note that black moisture barrier is present on the back sides of the blocks which is asbestos containing and PCB containing >50 PPM. Note the caulk is also asbestos containing.

PCB-08 Remove existing interior caulk & existing interior non-glazed porous cinderblocks a minimum of one full block from both sides of the corner and dispose of as PCB Bulk Product Waste >50 PPM. Note caulk contains asbestos. Note that black moisture barrier is present on the back sides of the outer wall blocks. This material is asbestos containing and is >50 PPM PCB containing.

PCB-09 Remove and dispose of interior wood and ceramic flooring system and mastic and dispose of as PCB Waste >1 PPM <50 PPM. Note the mastic under the wood flooring system is asbestos containing.

PCB-10 Existing floor slab under the wood and ceramic floor system shall be bead blasted to remove all remnants of the mastic/paper barrier. Waste generated shall be disposed of as PCB Waste >1 PPM <50 PPM. Note the mastic under the wood flooring system is asbestos containing.

PCB-11 Remove existing unit ventilators and dispose of as PCB Bulk Product Waste >50 PPM.

PCB-12 Remove existing interior hall door caulk for disposal as PCB Waste >1 PPM <50 PPM. Note caulking also contains asbestos.

PCB-13 Remove and dispose of non-porous door assemblies including glass, glazing compounds, panels, insulation, etc. as PCB Waste <50 PPM.

PCB-14 Remove existing interior masonry at door opening jams a minimum of one full cinderblock for disposal as PCB Waste <50 PPM.

PCB-15 Remove existing interior exit door caulk for disposal as PCB Waste >1 PPM <50 PPM. Note caulk contains asbestos

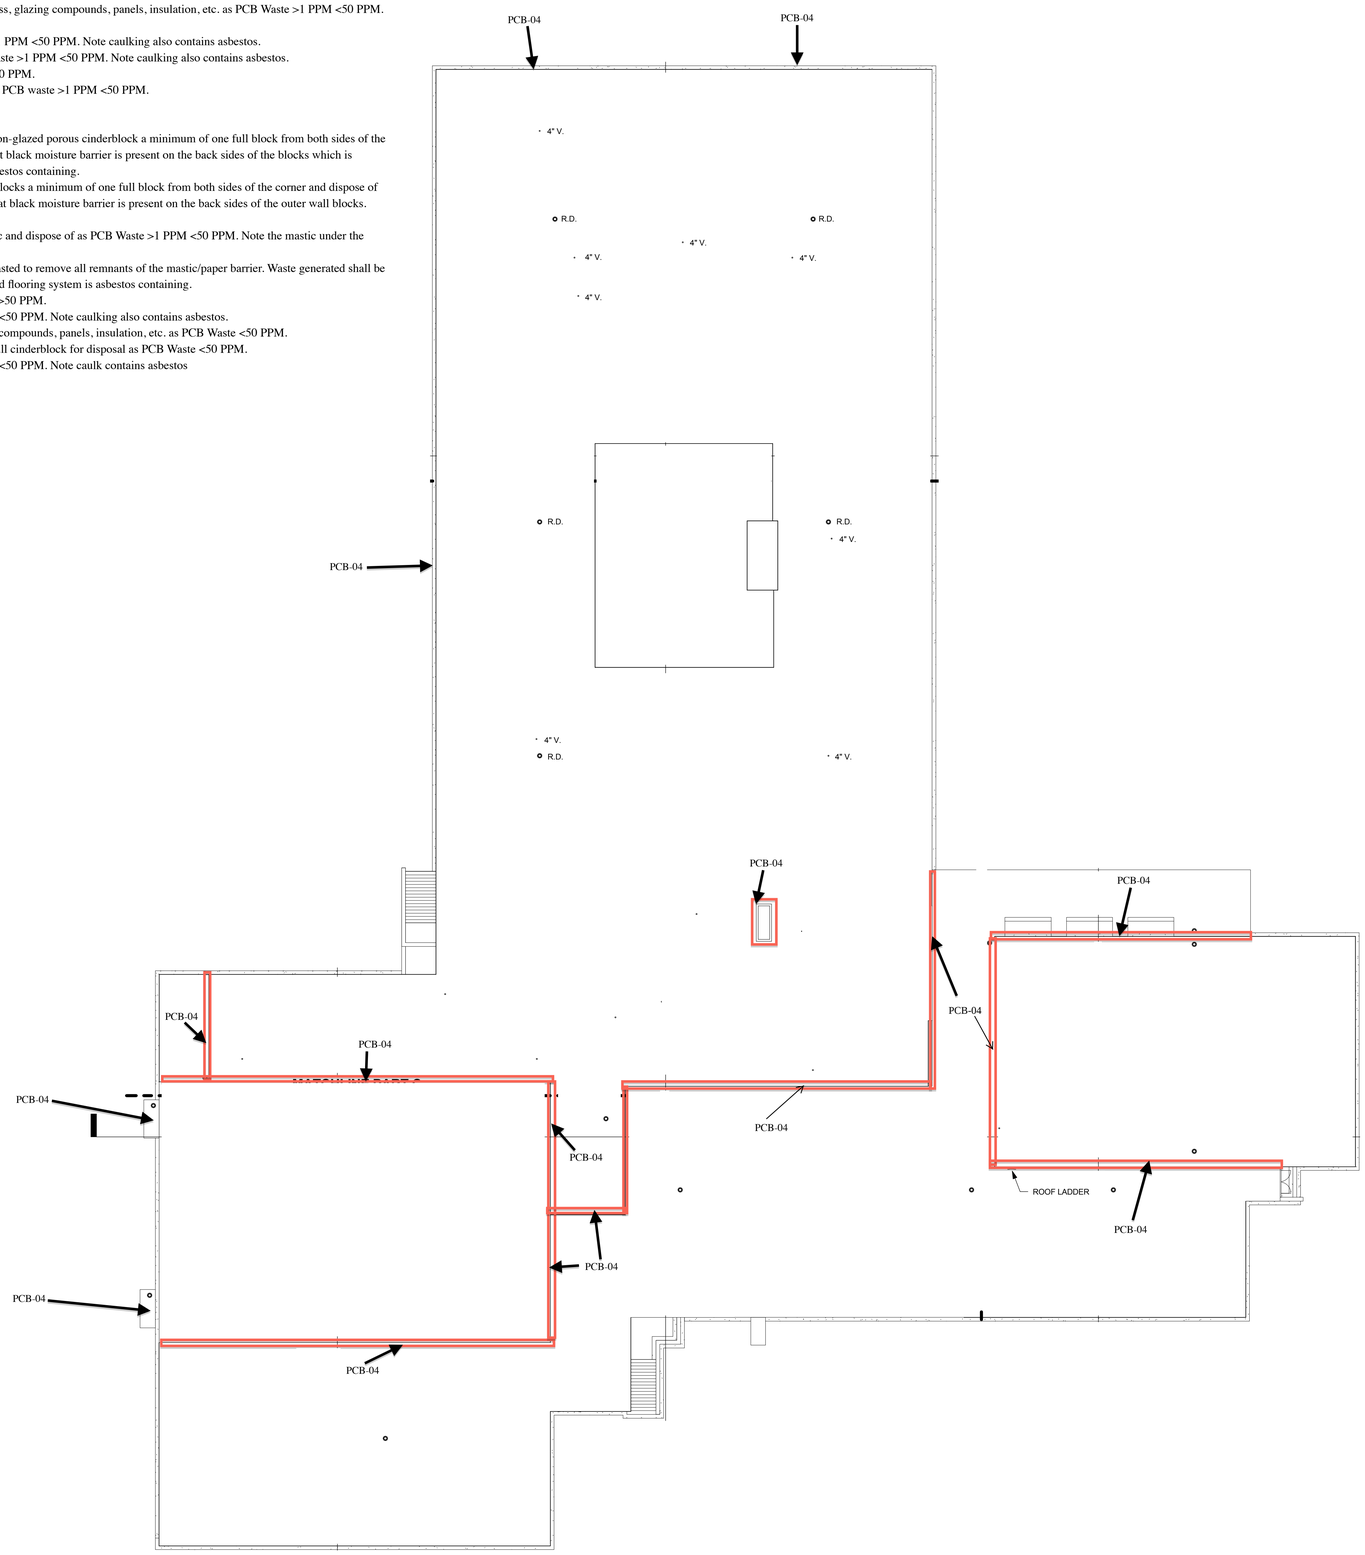

FLETCHERTHOMPSON
ELEVATING DESIGN | SHAPING SOLUTIONS

ARCHITECTURE I ENGINEERING I INTERIOR DESIGN

SHELTON, CONNECTICUT	203 - 225 - 6500
HARTFORD, CONNECTICUT	860 - 249 - 0888
SOMERSET, NEW JERSEY	732 - 907 - 6800
NEW YORK, NEW YORK	212 - 695 - 4767
NAPLES, FLORIDA	239 - 687 - 1220
BOSTON, MASSACHUSETTS	617 - 524 - 5200

CONSULTANT:

KEY PLAN:

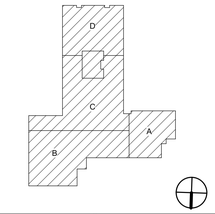

Revisions

NO	DATE	DESCRIPTION

PRINCIPAL IN CHARGE: J. COSTA
PROJECT MANAGER: J. COSTA
DESIGNER: M. BERGER / D. DAVIS
PROJECT ARCHITECT / ENGINEER: B. STANCAVAGE
DRAWN BY: Author
PROJECT:

JOSEPH A. DEPAOLO MIDDLE SCHOOL

385 PLEASANT STREET
SOUTHINGTON, CT 06489

STATE PROJECT NO. 131-0127 EA/RR/PS

DRAWING TITLE:

EXTERIOR ROOF
PCB ABATEMENT

DATE: December 14, 2012
SCALE: 1/16" = 1'-0"
PROJECT NUMBER: CT 12110
DRAWING NO.: HA-006D

7/13/2012 5:07:28 PM C:\Users\bstancavage\Documents\2012 - Arch - Southington_bstancavage.rvt